Temperature and Humidity Transducer with Bacnet & Modbus port

Description

Duct temperature and humidity sensor / transmitter is applicable to all kinds of building automation, environment monitoring, HVAC systems. Product appearance is simple, direct connection terminals, convenient installation. Products use high performance embedded microprocessor, and high-precision sensors to meet all kinds of high precision, high stability of the temperature and humidity measurement requirements, and variety needs of different environments. Duct temperature sensor / transmitter has current, voltage, 485 output signal to select, using 485 serial port out put and Modbus communication protocol. It is commonly used in HVAC, electrical plant, environment monitoring, dynamic environment monitoring, agricultural environmental monitoring, meteorological environmental monitoring, environmental monitoring of biological pharmacy, airport, subway stations, hotel, museum,

Higslights

- -High precision temperature and humidity sensor
- -Applicable to all types of air environmental monitoring
- HVAC systems
- -Advanced circuit design, high accuracy, stable performance
- -Appearance is concise, easy to install, cost-effective


Specifications

Typical Applica-	Duct mount indoors	
Output Signal Type	4-20mA,0-10V	
Output Signal Drive	>500Ω for mA mode,75mA max output drive for voltagemode	
Power	15-24V+/-10%, AC or DC,1watt typical	
Operating Temp	-30~+60°C,0-95%non condensing	
Plastic Housing	Flammability rating UL94V0 file E194560	
Control Features	N/A	
	Sensor Type	Capacitive
HUM	Range	0-100%Non-Condensing
110111	Accuracy	5%@25°C,20~80%
	Drift	<0.5%RH/year
	Sensor Type	10K thermistor
TEMP	Range	-40~150°C(-60~340°F)
	Accuracy	<±0.5°C@25°C
Size	72.2mmX64mmX38.4mm	






Dimension

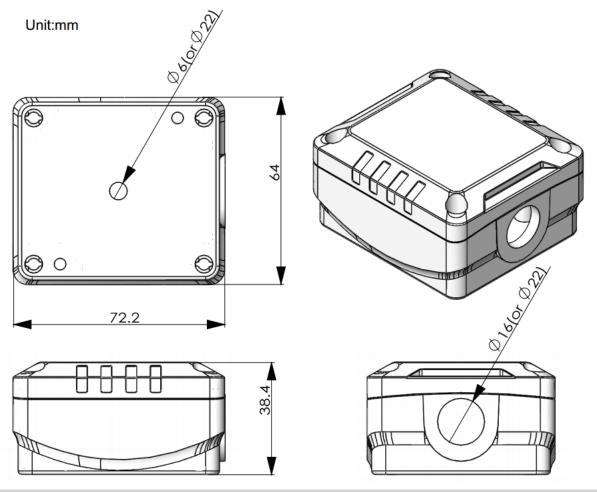


Wiring Diagram

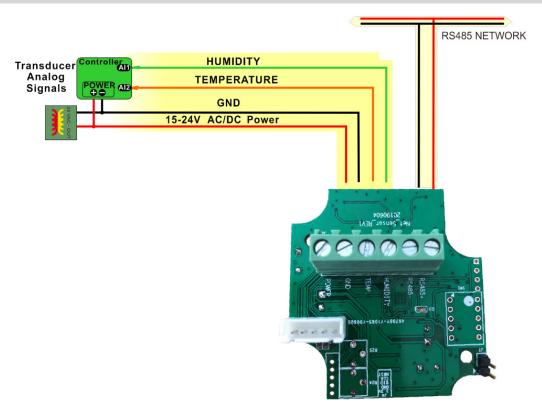

Modbus Register List

ADDRESS	Register Description	
0-3	Serial number	
4	Software version	
6	Modbus Address	
8	Hardware version	
17	Switch 5, 1=010V, 0=420mA	
18	Switch 1-2, 0=0-100,1=-2080,2=050,3=-5050	
19	Switch 3-4, 0=dewPoint, 1=enthalpy, 2=absolute humidity,3=real humidity	
25	potentiometer R1 AD value	
27	potentiometer R2 AD value	
34	SHT 35 Temperature	
35	SHT 35 Humidity	
45	NTC temperature	
36	potentiometer R1 offset value	
37	potentiometer R2 offset value	
38	Temperature with offset	
39	Humidity with offset	
41	Dew point value	
42	Enthalpy value	
44	bsolute humidity	
51	est switch, if on, input voltage to register 52,53	
52	Input voltage for Temperature output, 500 mean 5.00 v	
53	input voltage for humidity output, 500 mean 5.00 v	
54	input current for temperature output, 4 mean 4mA	
55	input current for humidity output, 4 mean 4mA	
60-76	NTC sensor 17 calibration points	
80	NTC sensor's AD value	

Part Number Scheme

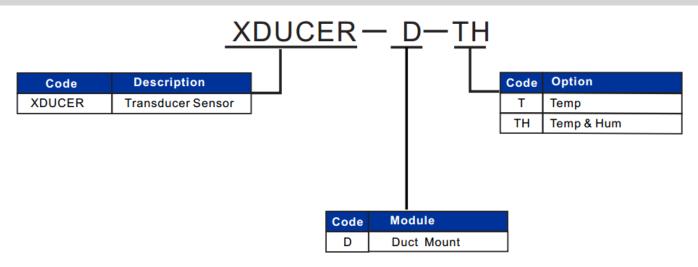

Mounting Installation


1)slotted screwdriver




Captiver screw(slotted screw)




2)Unfasten screw at cover,turn the captive screw ½ turn till it pops out

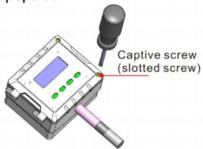


3)Open the cover

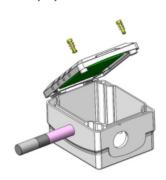


4)There are three small holes as red arrows showed below inside the box for fastening self tapping screws drilling the hole in the duct with a template

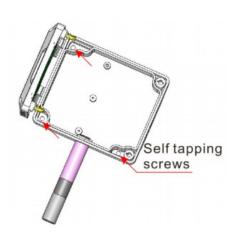

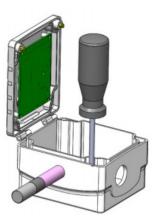

5)Re-fasten screw at cover

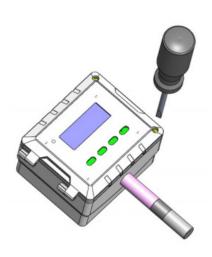

Bachnet Object List

Supported BACnet Object Types
analog-value, device
Supported BACnet Services
who-is, i-am
object-identifier, object-name, object-type, present-value, units, object-list, vendor-id, vendor-name, system-status, confirmed-service, unconfirmed-service

MSTP Object		
	AV0:baudrate select	
Analog-value	AV1:Temperature range	0=0-100°C; 1=-2080°C ;2=050°C; 3=-5050°C
	AV2:Humidity range	0=dewPoint, 1=enthalpy, 2=absolute humidity,3=real humidity
	AV3:Protocol	0: Modbus; 1:Bacnet
	AV4:Output type	0: 4~20mA; 1: 0-10V
	AV5:Temperature	
	AV6:Reality Humidity	
	AV7:Absolute Humidity	
	AV8:Dew Point	
	AV9:Enthalpy	
	AV10:Temperature Offset	Range: -4.0 ~ 4.0
	AV11: Humidity Offset	Range: -4.0 ~ 4.0
Device	device-identifier,device-name	

